


SpeedBox 3.3 for Ginat

STEP 1: Preparation for installation


- A. Prepare the following tools:
 - 1. Hex Key H8
 - 2. Hex Key H3
 - 3. Hex Key H2.5
 - 4. IHex Key H2
 - 5. T25 Torx screwdriver
- B. Turn off the e-bike.
- C. Remove the battery from the e-bike according to the manufacturer's manual.

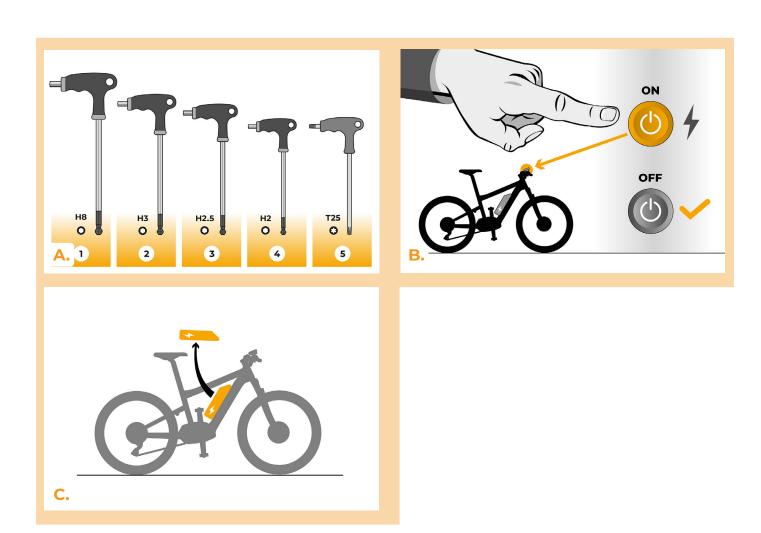



STEP 2: Crank removal


- A. Remove the crank bolt of the left crank arm using the hex key H8. If the crank is not self-extracting, it is necessary to use a crank puller please see the User manual on our website.
- B. Remove the crank arm from the central axis of the motor.

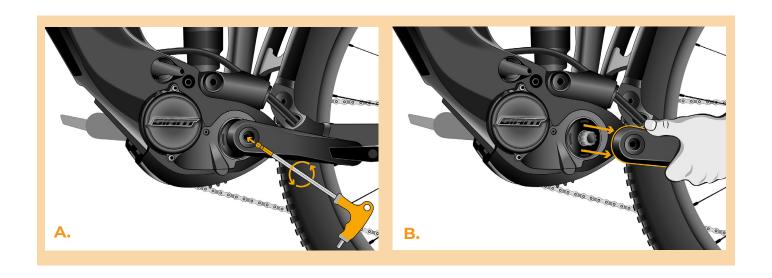



STEP 3: Motor cover removal


- A. Unscrew the four screws holding the lower motor cover with the hex key H2.5.
- B. Remove the motor cover.
- C. Unscrew the three screws holding the side motor cover with the hex key H3, H2.5, H2.
- D. Remove the side motor cover.

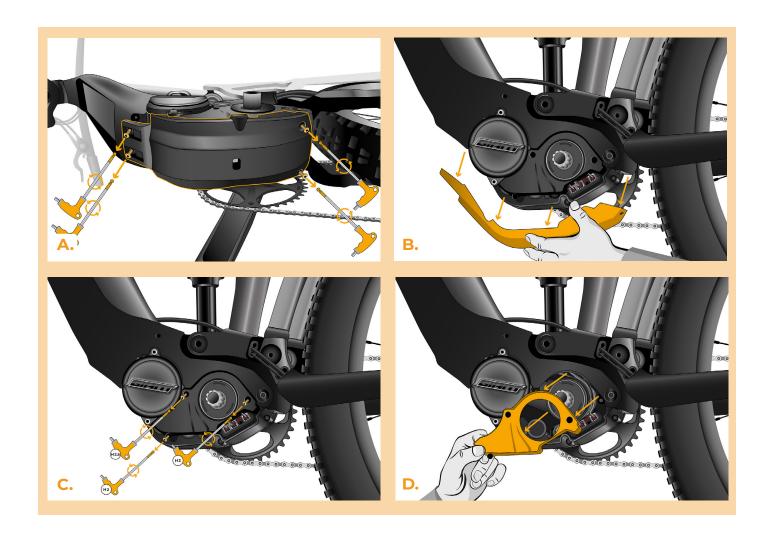



STEP 4: Disconnecting the connectors from the motor


- A. Disconnect the speed sensor connector.
- B. Disconnect the display connector in the same manner.

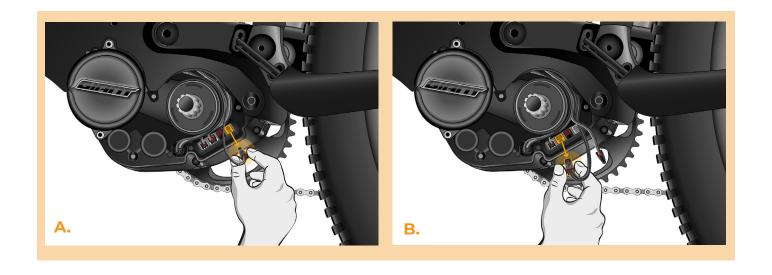




STEP 5: SpeedBox tuning installation

- A. Plug SpeedBox into the disconnected connectors (step 4).
- B. Make sure that the locks on the connectors are seated properly.
- C. Před zakrytováním motoru zkontrolujte správné zapojení podle obrázku.

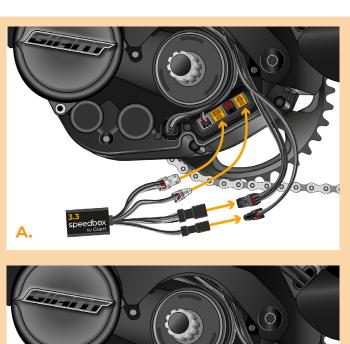

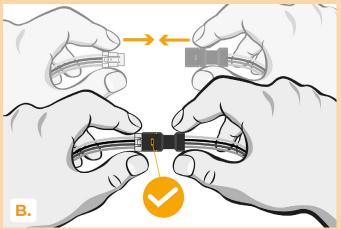






STEP 6: Motor cover assembly


- A. Fit the SpeedBox and all connectors and wires leading from the motor into the free space under the side motor cover.
- B. Put the side motor cover back (1.) and tighten the three screws with the hex key H3, H2.5, H2 (2.).
- C. Put the lower motor cover back.
- D. Attach the motor cover with 4 screws (H2.5).

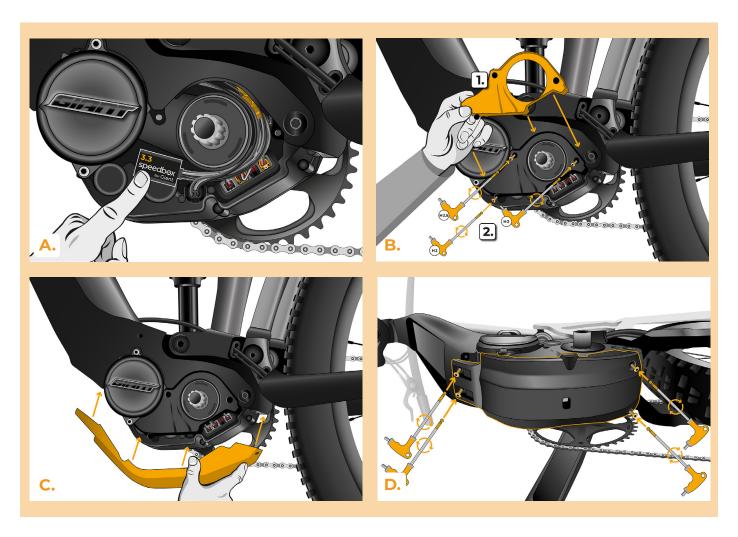



STEP 7: Motor cover assembly


- A. Put the crank arm back to the central axis of the e-bike motor.
- B. Screw the crank bolt into the crank arm and tighten it with the hex key H8.

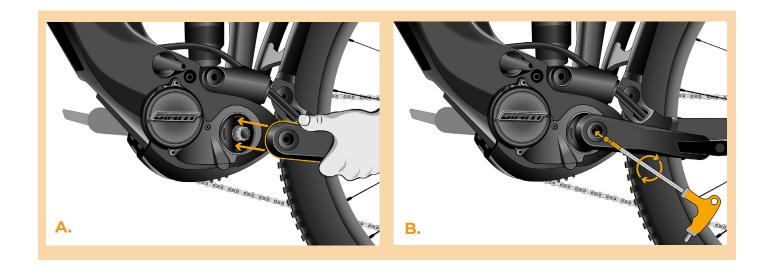



STEP 8: Tuning function check


- A. Place the battery back into the e-bike.
- B. Turn the e-bike on.
- C. You will activate/deactivate tuning by brief activation of the WALK function or by switching between two assistance modes twice (+ + -). The value of 5.0 or 2.5 indicating the maximum speed of 50 or 25 km/h will be displayed.
- D. Spin the rear wheel and make sure the rear wheel speed is shown on the e-bike display.

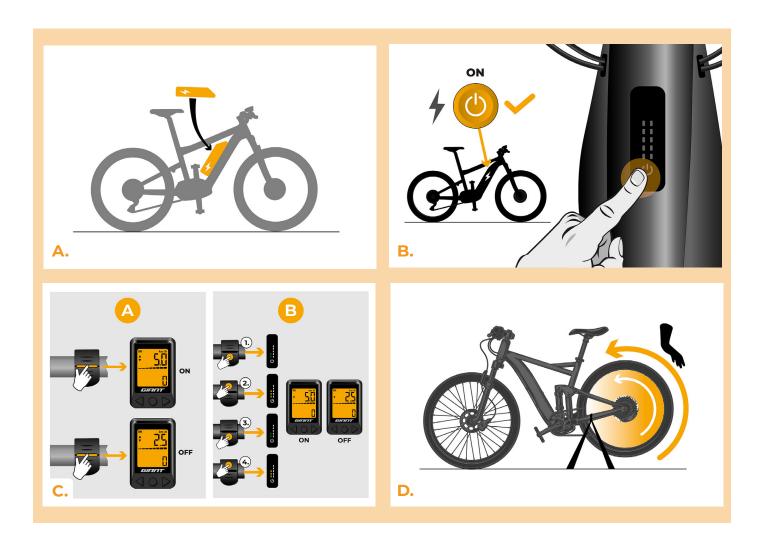




STEP 9: Setting the speed limit

- A. To set the maximum speed limit, switch the modes: - + + +. The current speed limit will be displayed.
- B. Set the maximum speed limit by pressing the WALK button briefly or by turning the rear wheel 360°. With each brief activation of the WALK function or turning of
br>the wheel, the limit increases by 5 km/h. The last displayed limit is saved after five seconds of inactivity.

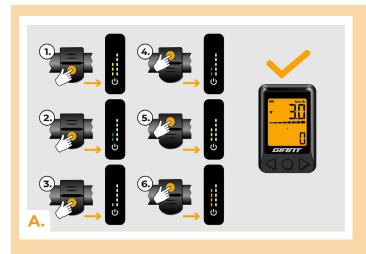



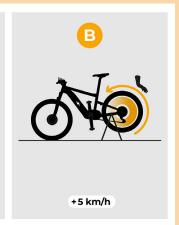



www.speedbox-tuning.com

Ebike Electronic s.r.o.

Rybna 716/24 | 110 00 Praha 1 | Czech Republic | ID: 05553555 | VAT: CZ05553555







